

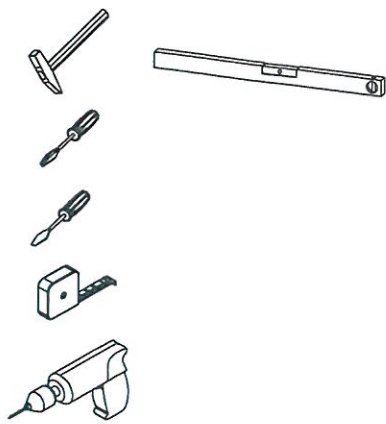


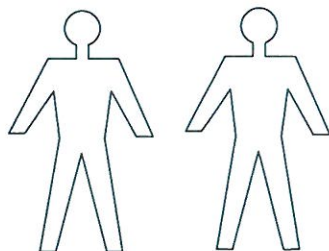

SALZBURG

22270001 / 01
22270001 / 02

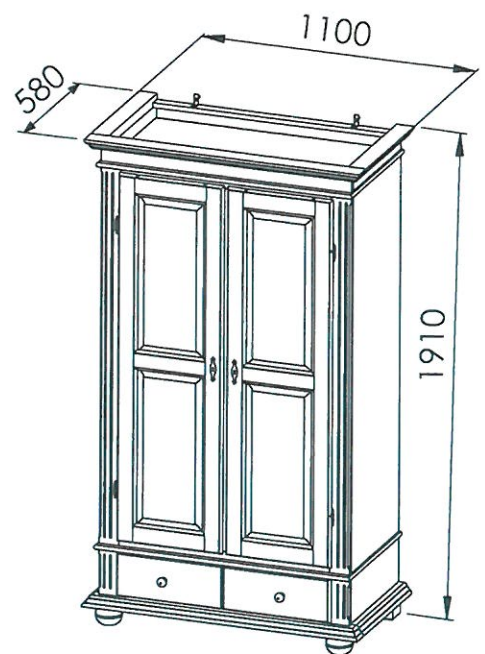











90'

A $\varnothing 8 \times 30$ x53	B $\varnothing 10 \times 40$ x4	C 1x	D x4	F $\varnothing 3,5 \times 25 \text{ mm}$ x2	G $\varnothing 3,5 \times 35 \text{ mm}$ x12
H $\varnothing 7 \times 70$ x6	I x1	J $\varnothing 2,9 \times 16 \text{ mm}$ x42	K x20	L $\varnothing 25 \text{ mm}$ 18x	M x4
N x2	O $\varnothing 3 \times 16 \text{ mm}$ x14	Q $\varnothing 3 \times 20 \text{ mm}$ x9	R x2	S x4	T x1
U x2	W 2x x2	Z $\varnothing 3,5 \times 40 \text{ mm}$ x8	Y x2	X x1	V x1
AA x2	AC 1489 mm 1x	AD x1	AE x2	AG x2	AH $\varnothing 5 \times 50 \text{ mm}$ x2
AJ $\varnothing 8$ x2					










No.	L	B	T	Pcs.	Colli
1	1020	555	16	1x	2/2
2	100	100	70	2x	2/2
3	80	40	70	2x	2/2
4	1490	511	16	1x	1/2
5	1490	511	16	1x	1/2
8	1100	580	111	1x	2/2
11	960	490	16	1x	2/2
12	956	40	18	1x	2/2
13	1514	491	3.2	2x	1/2
14	840	30	16	1x	2/2
15	840	30	16	1x	2/2
16.1	183	511	16	2x	2/2
18	183	80	16	2x	2/2
19	504	25	25	2x	2/2
20.1	1100	580	40	1x	2/2
21	982	205	3.2	1x	2/2
22	854	177	18	1x	2/2

No.	L	B	T	Pcs.	Colli
23	425	155	16	1x	2/2
24	425	155	16	1x	2/2
25.1	798	424	3.2	1x	2/2
26.1	784	155	16	1x	2/2
27	450	16	16	1x	2/2
29	1428	34	10	1x	1/2
50	1490	80	16	1x	1/2
51	1490	80	16	1x	1/2
60	1450	420	19	1x	1/2
61	1450	420	19	1x	1/2

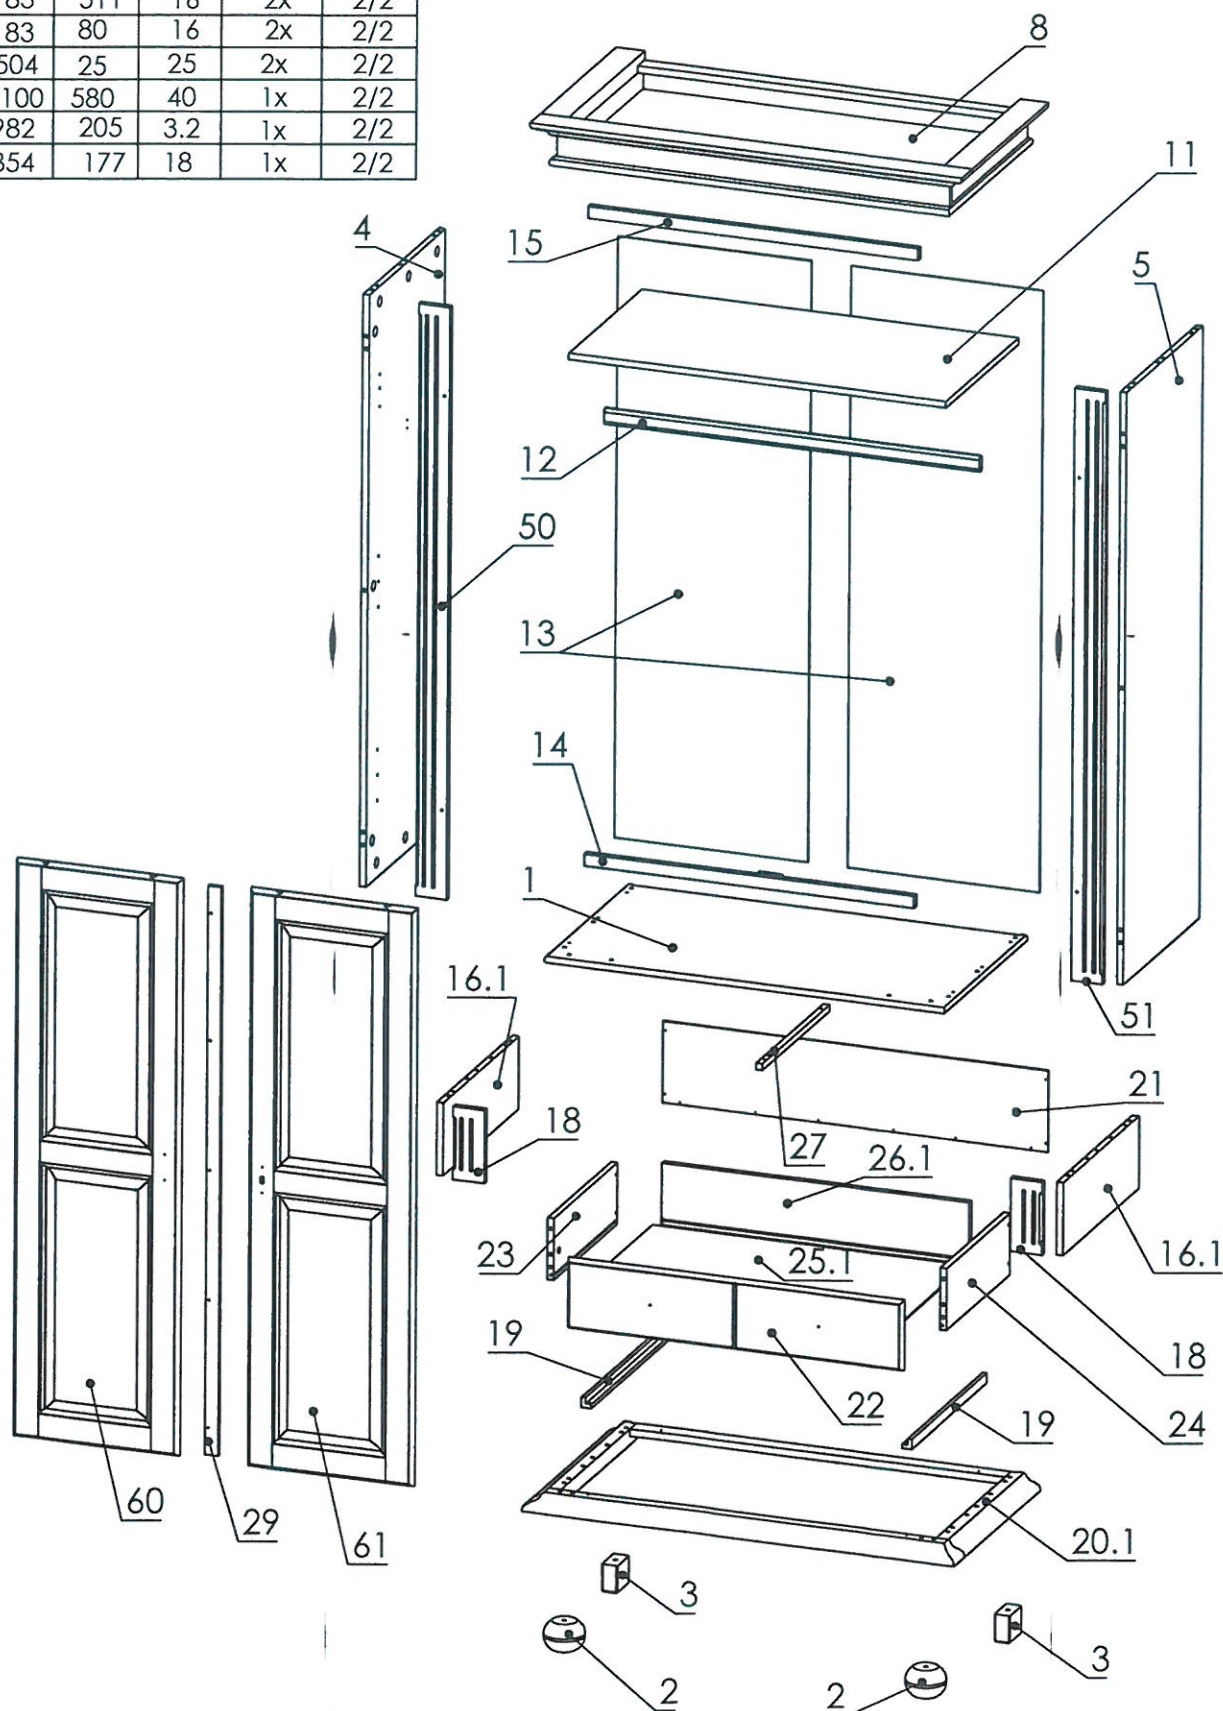


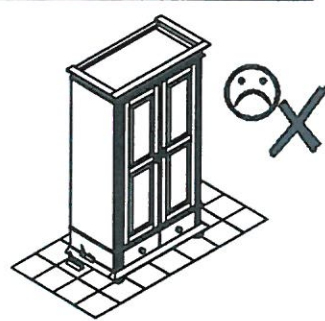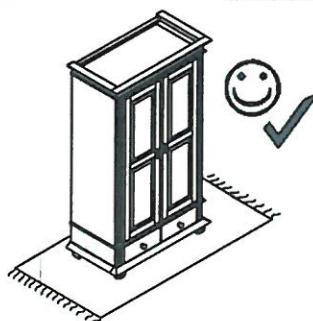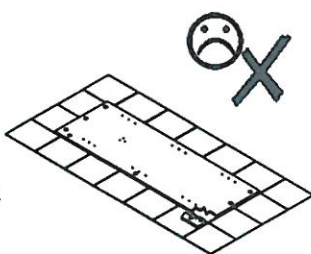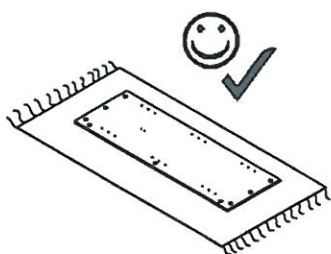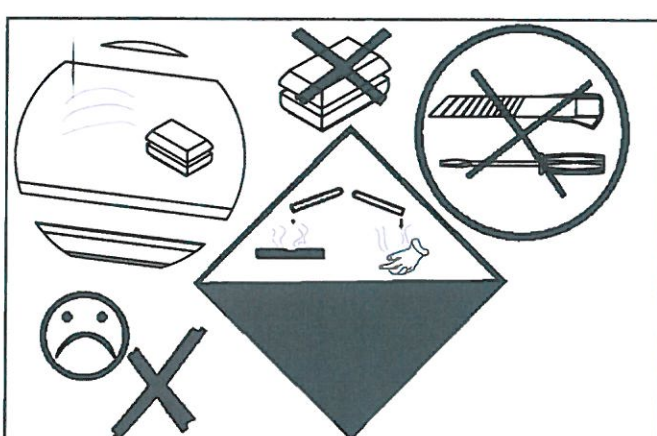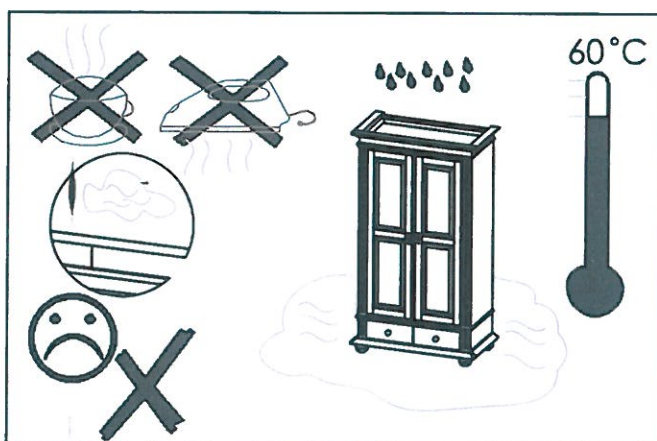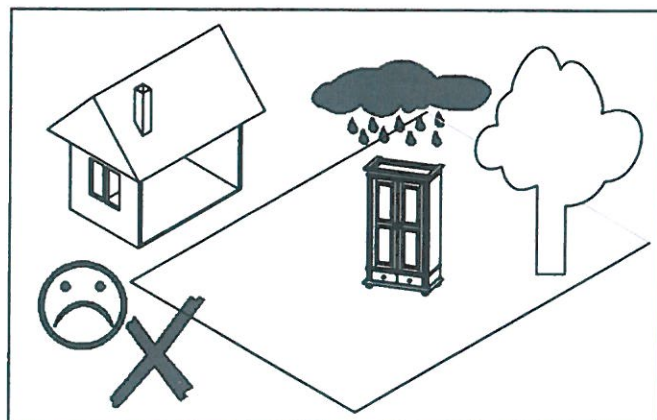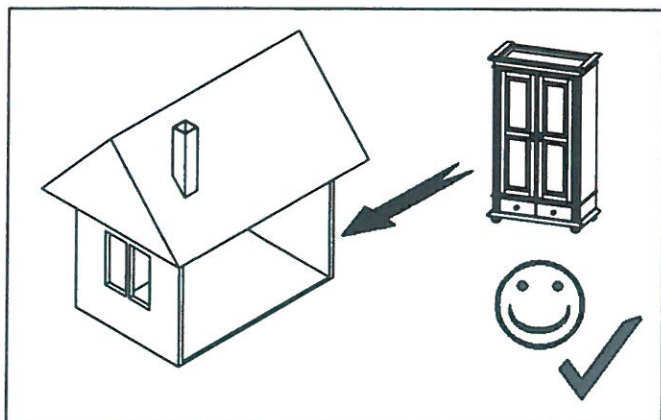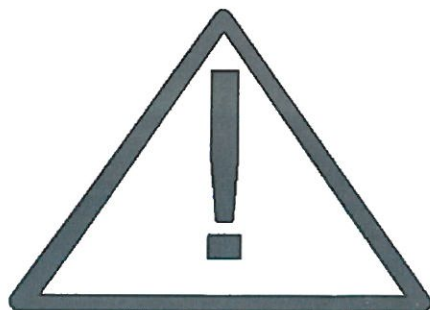


1.

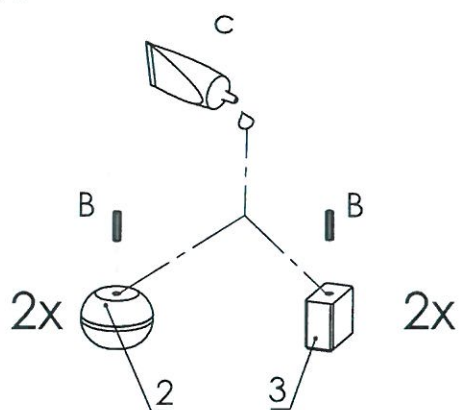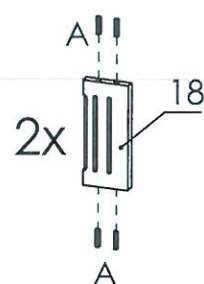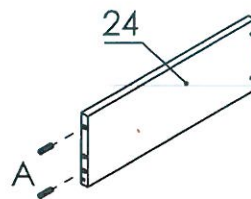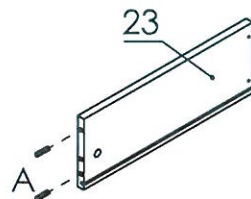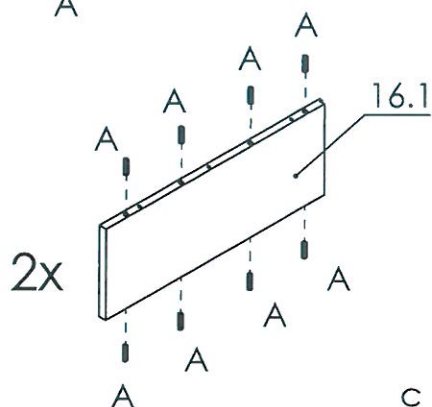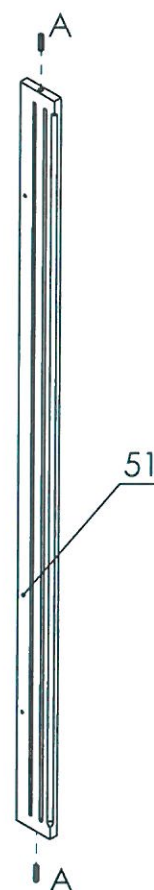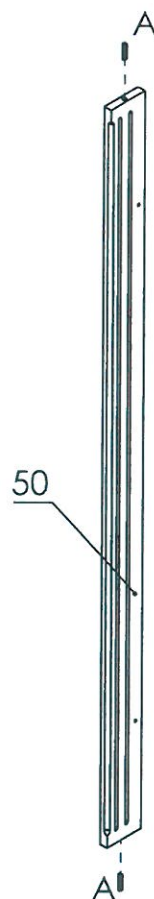
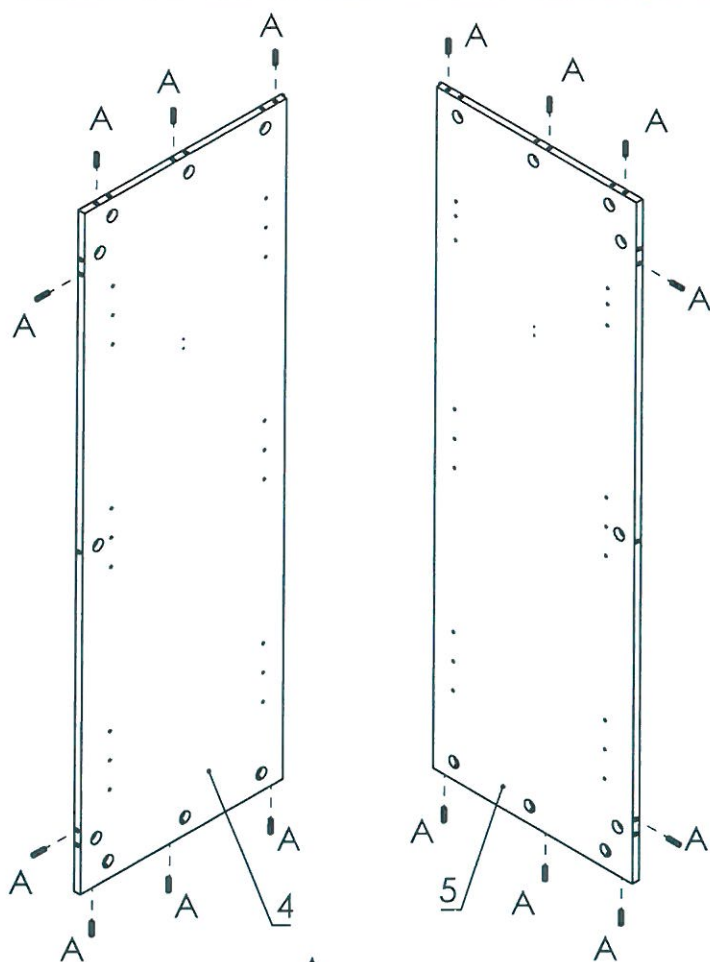
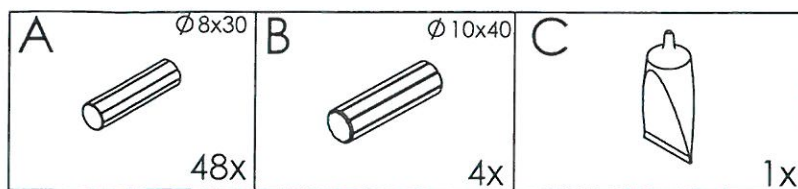


2.

Q	$\varnothing 3 \times 20$	F	$\varnothing 3.5 \times 25$	G	$\varnothing 3.5 \times 35$	H	$\varnothing 7 \times 70$	I	
									
4x		2x		8x		6x		1x	





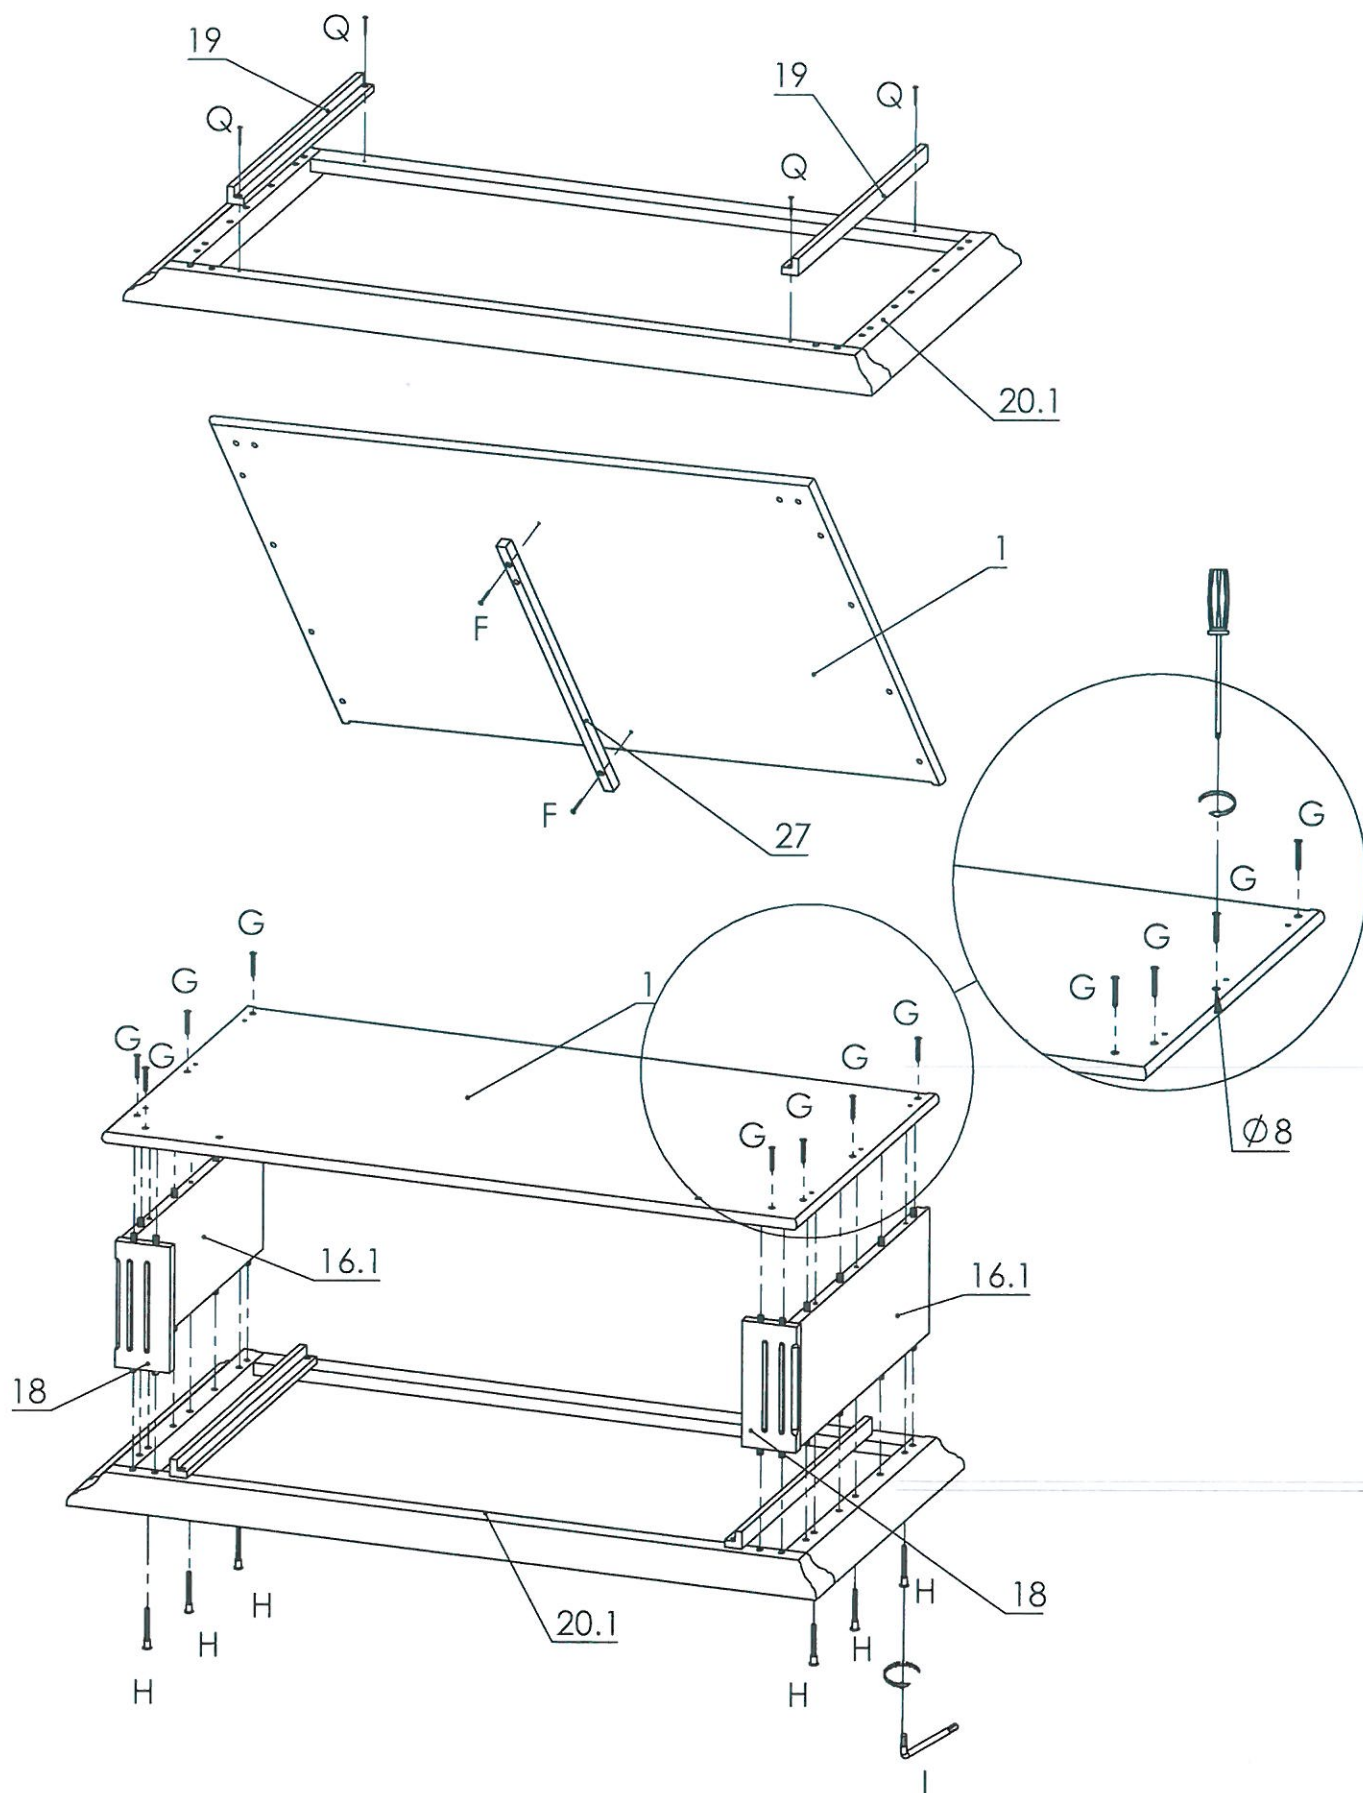


3.



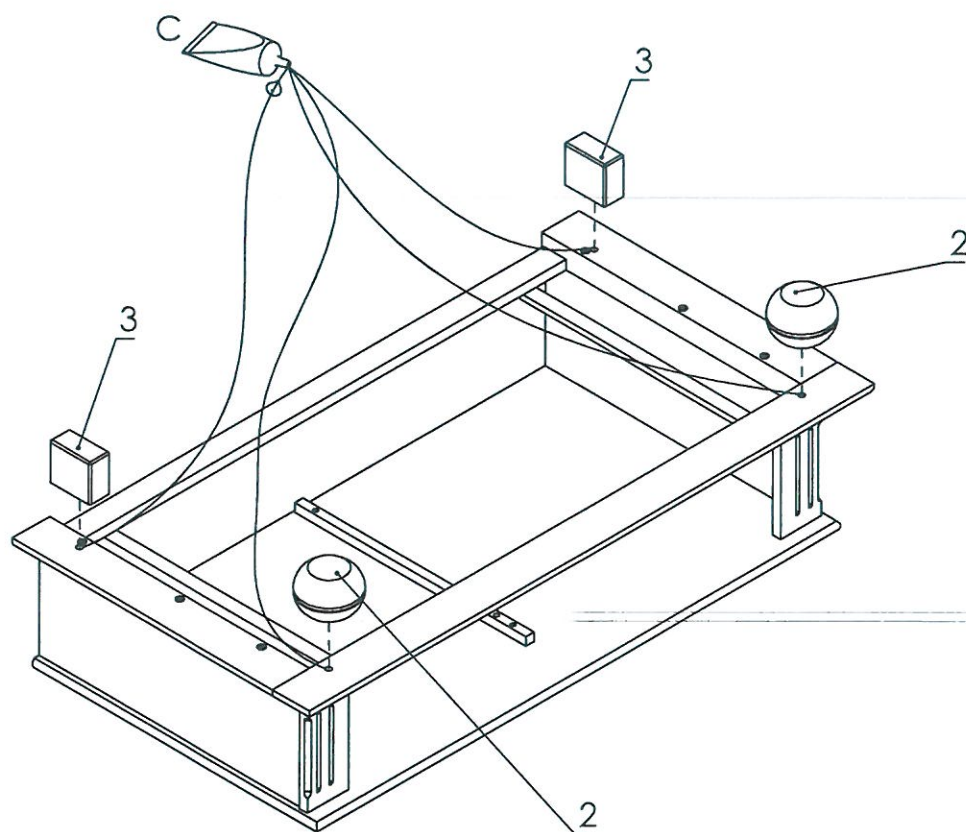
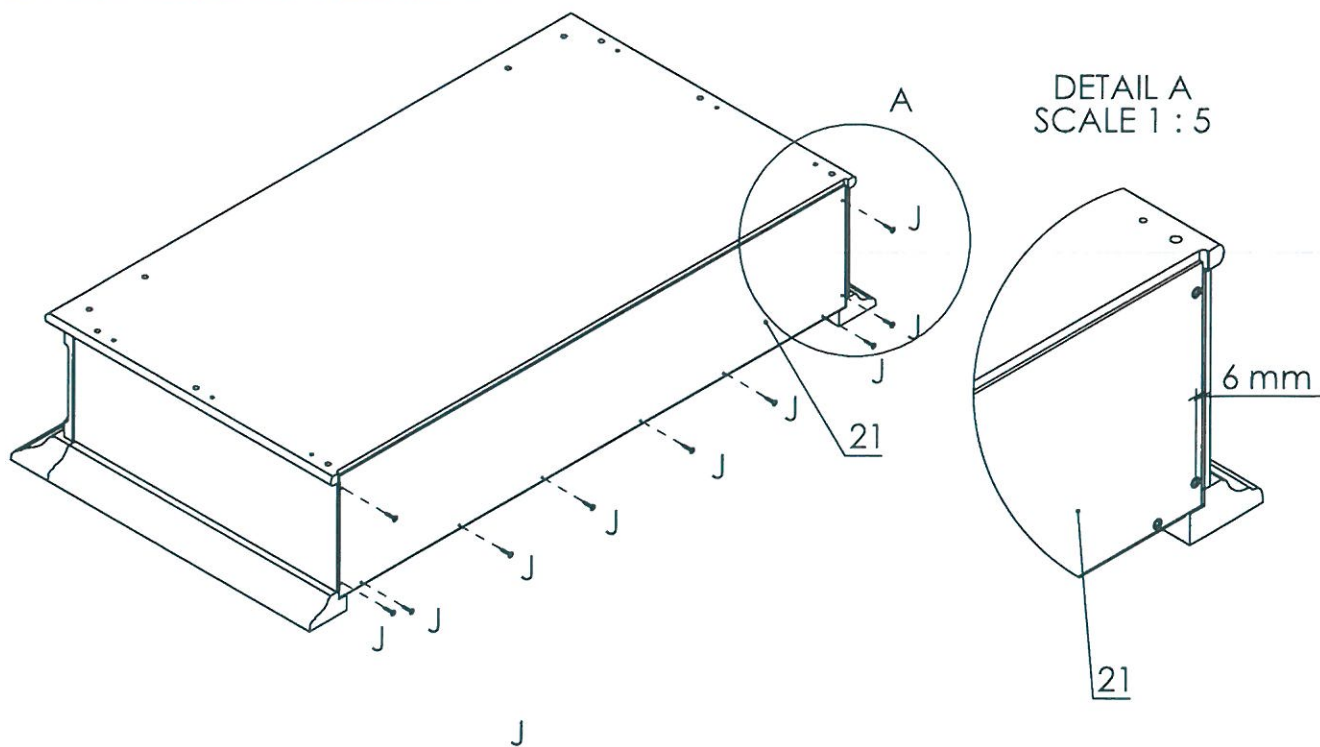
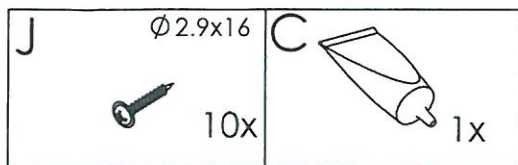


4.


K  6x	L Ø 25  6x	M  4x	N  2x	O Ø 3x16  4x
--	--	---	--	---

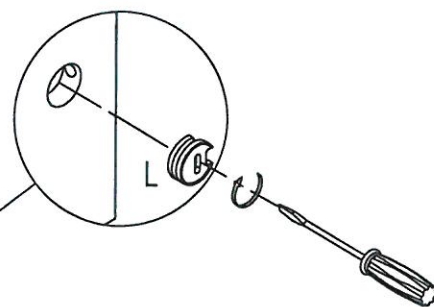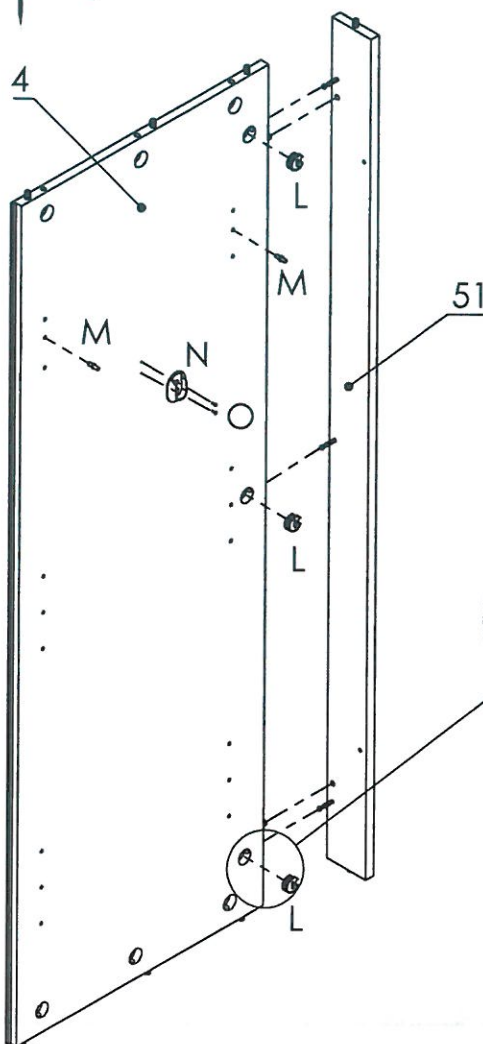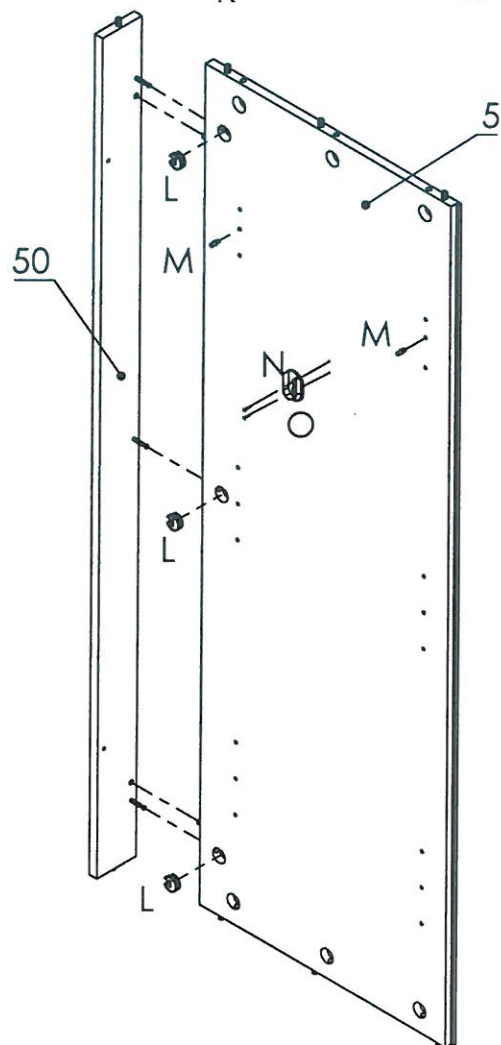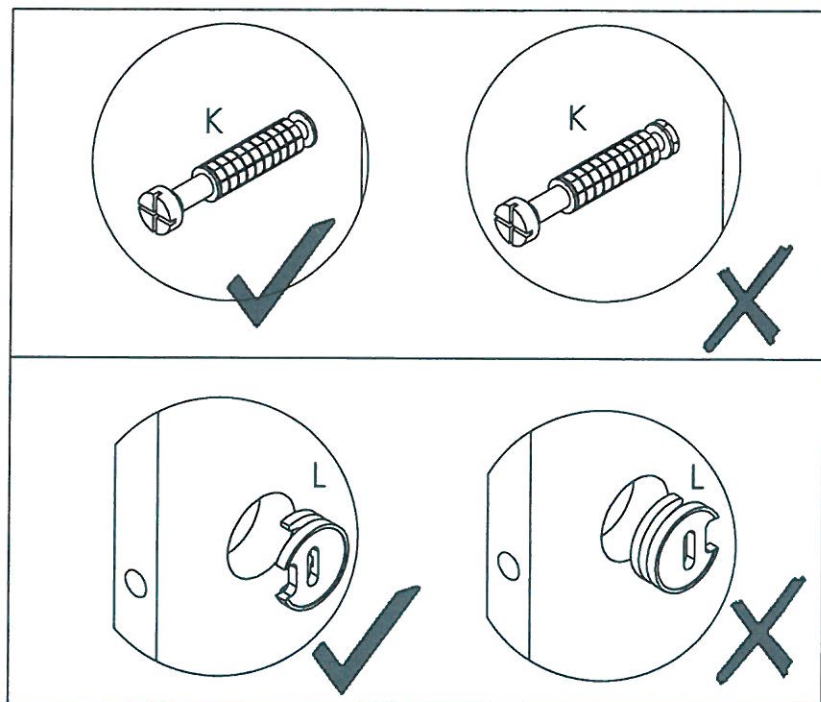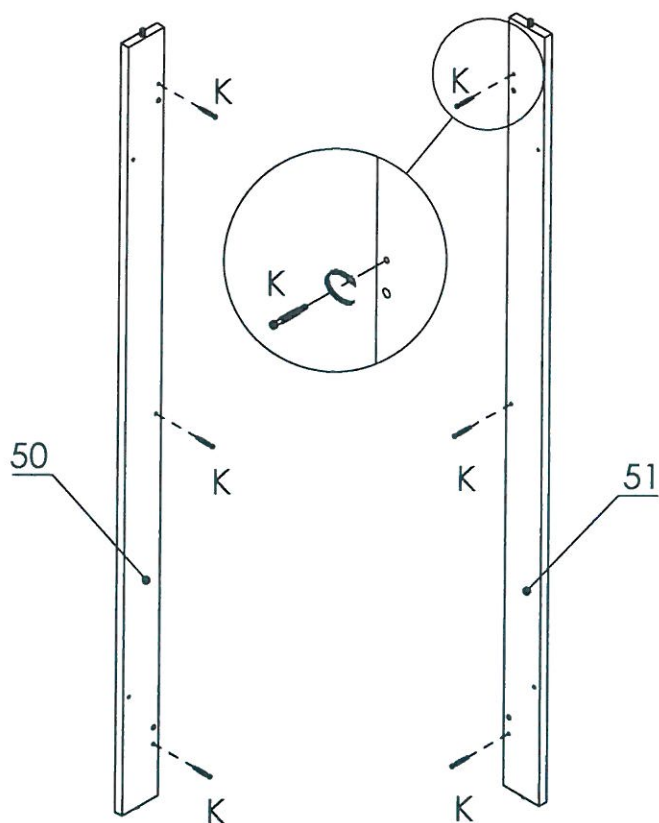

5.



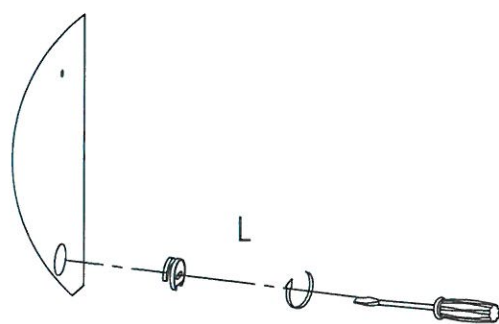
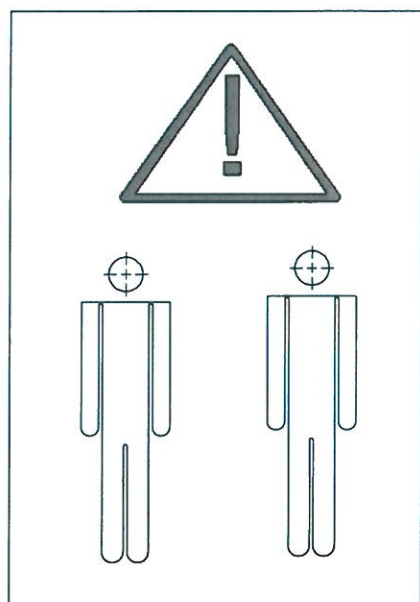
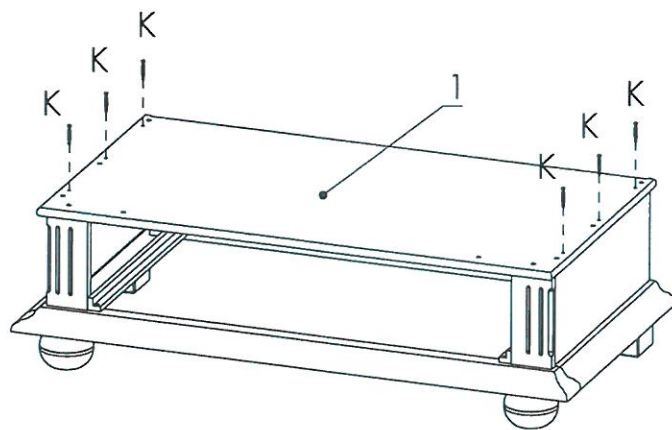
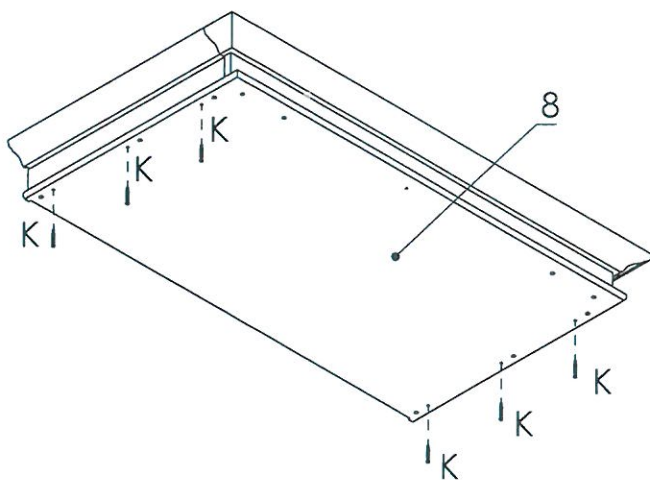
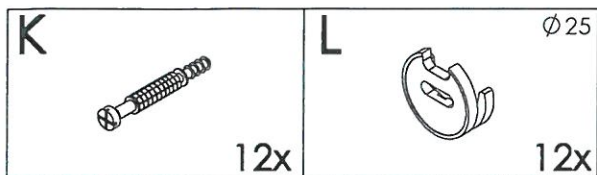


DETAIL C
SCALE 1 : 6

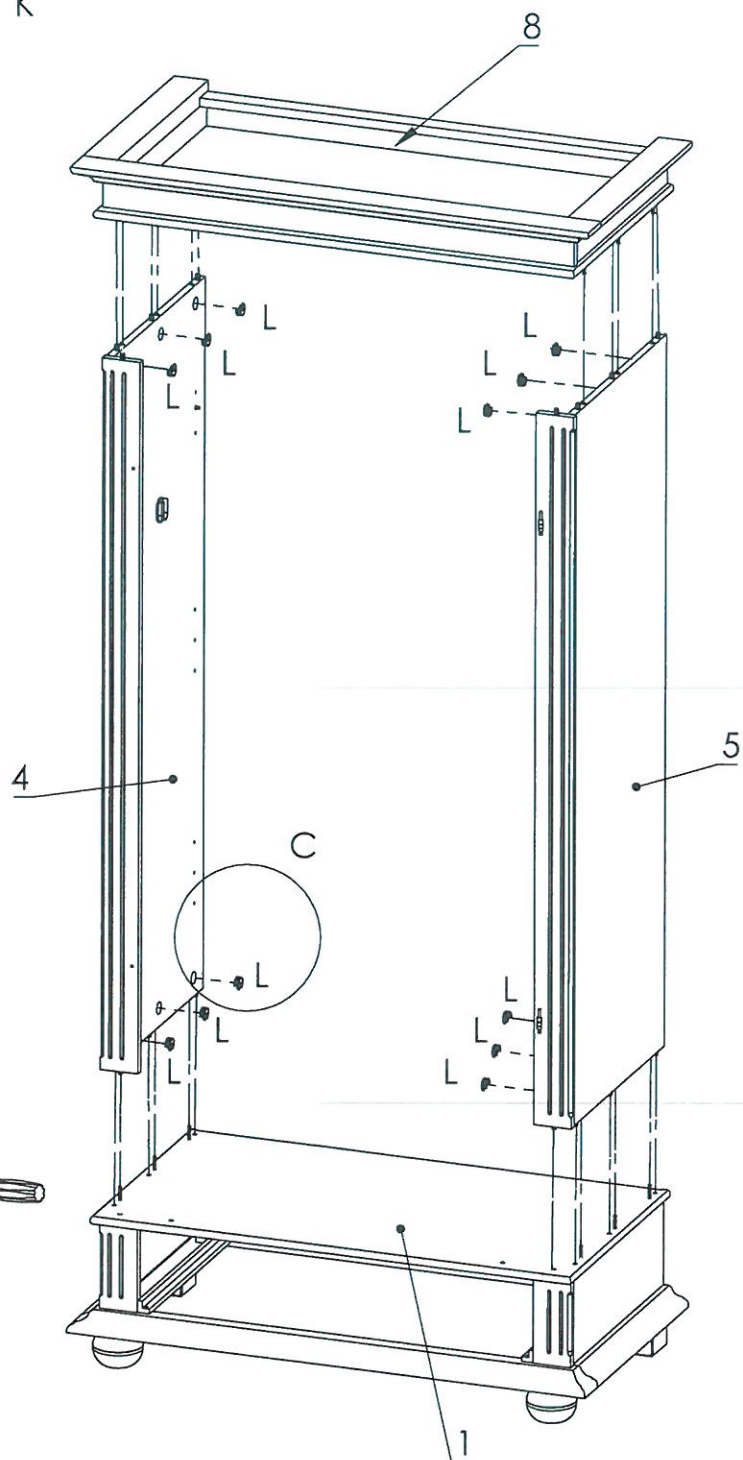


6.

R  2x	S  4x	O  6x Ø 3x16	X  1x	V  1x
---	---	--	---	---

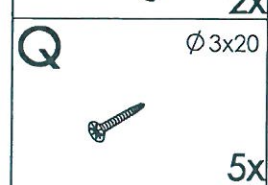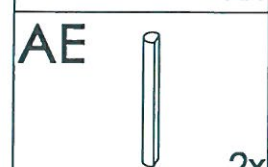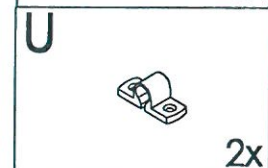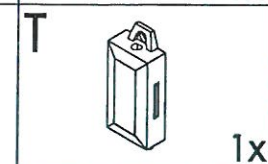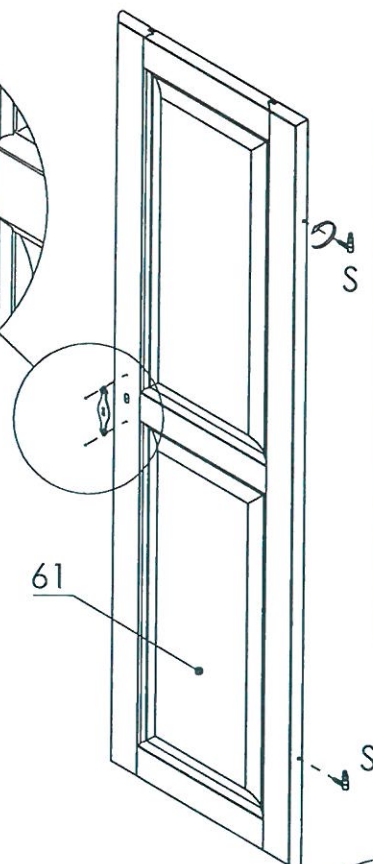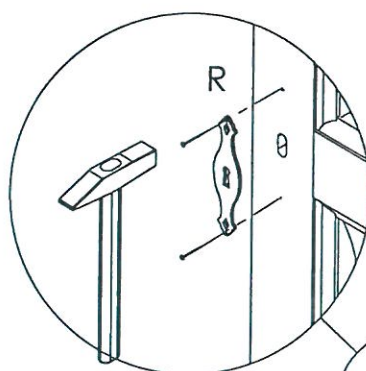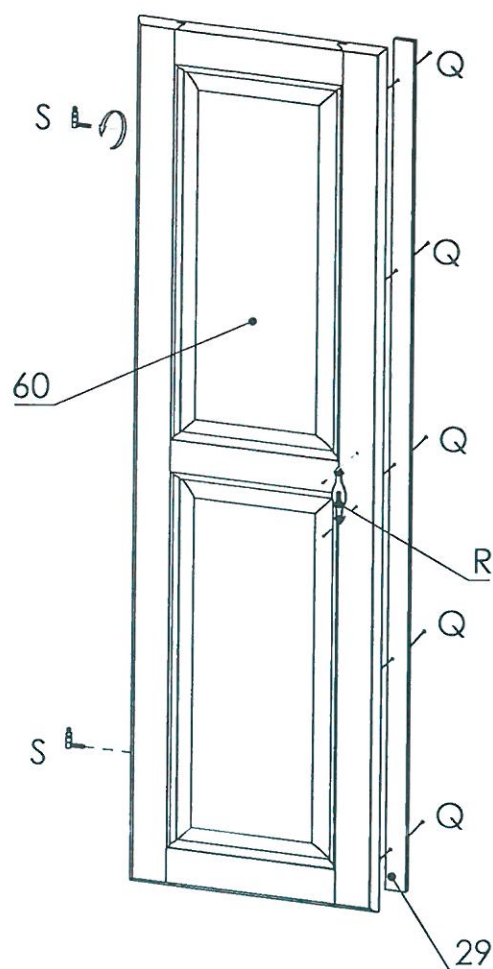


3 mm


DETAIL D
SCALE 1 : 4





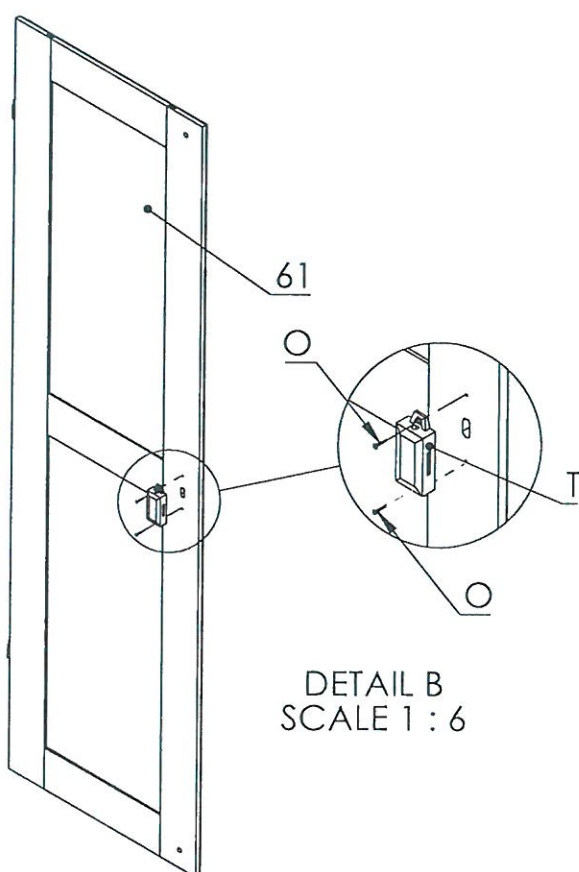


DETAIL B
SCALE 1 : 6



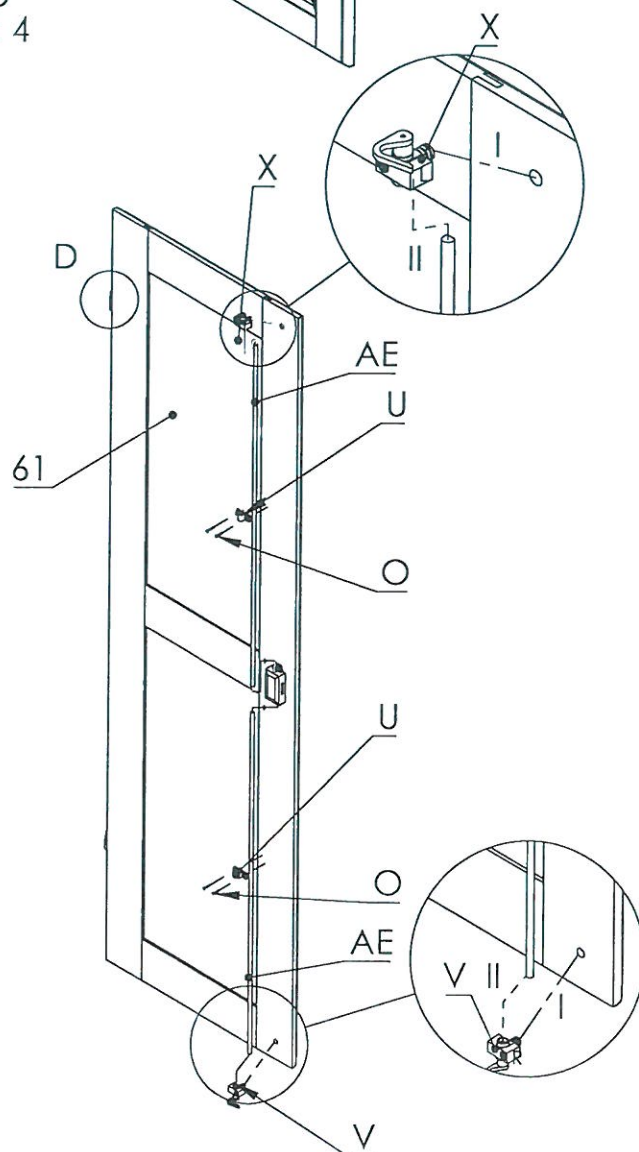


7.


A  4x Ø 8x30	K  2x	G  4x Ø 3.5x35	W  2x Ø 15	Y  2x
 22 K				Z  2x Ø 3.5x40

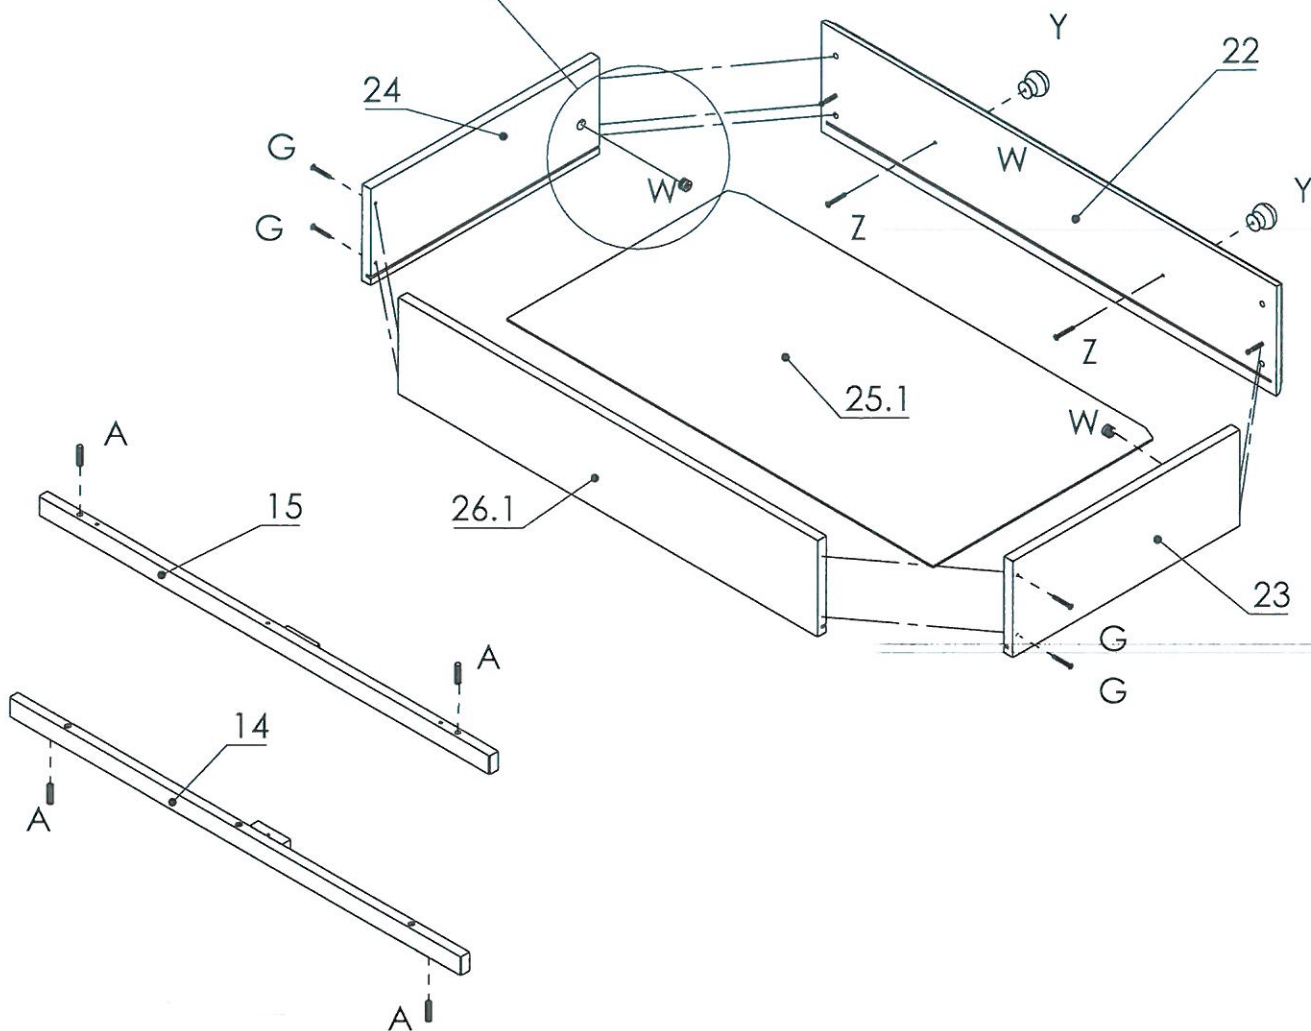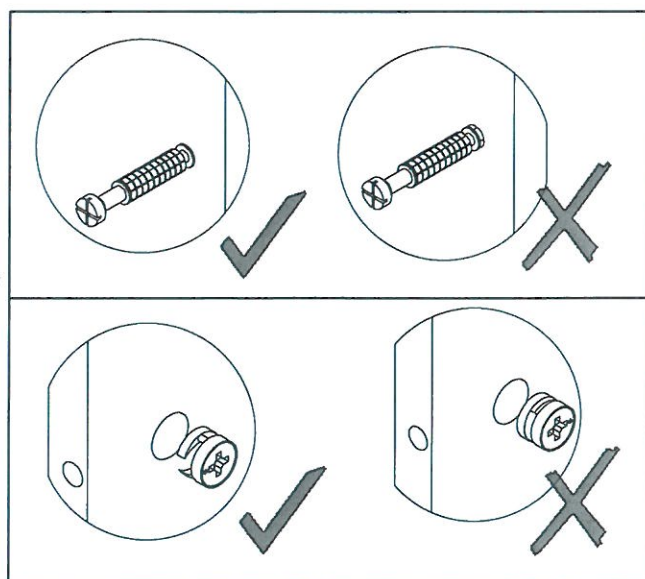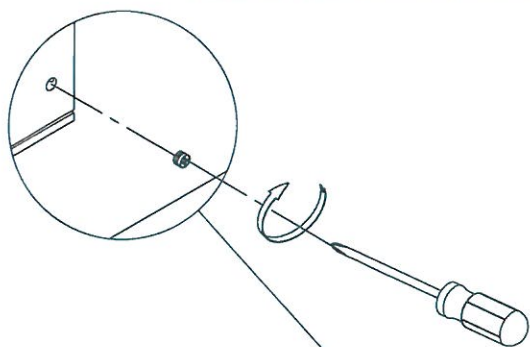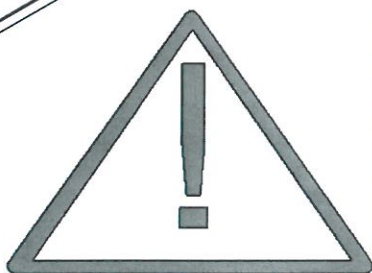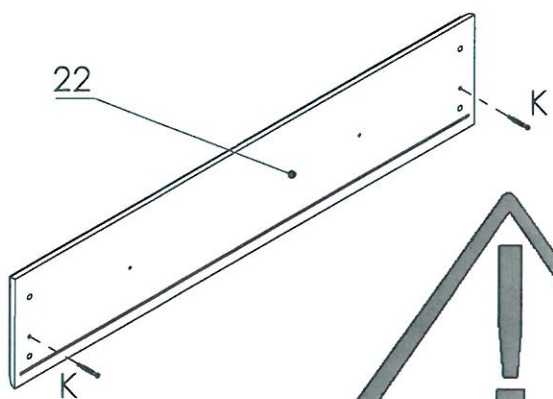


8.

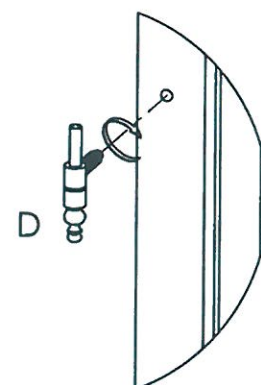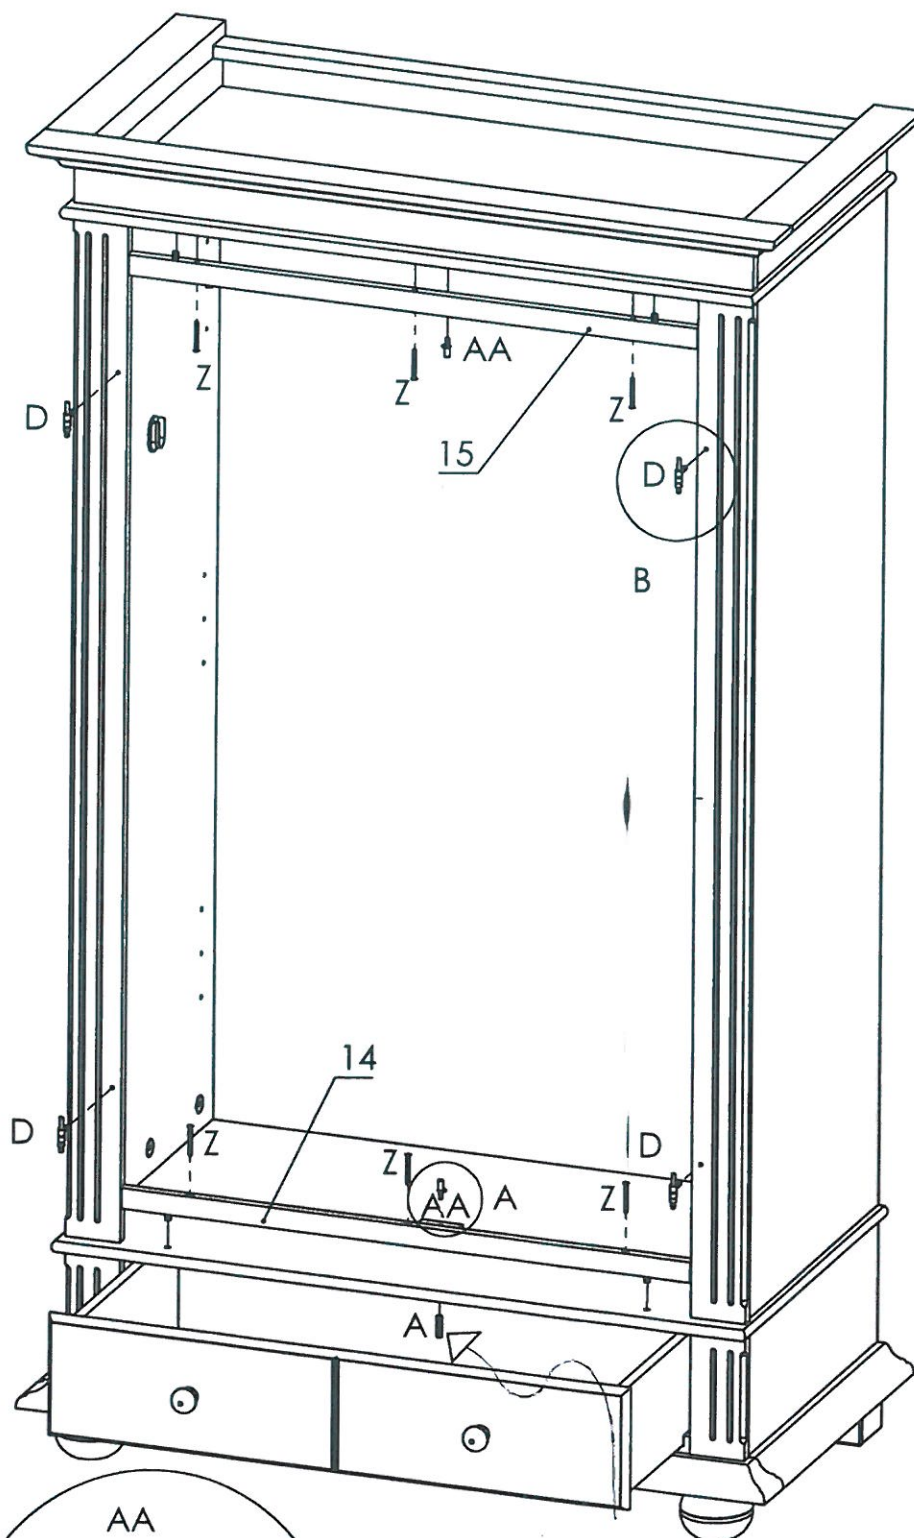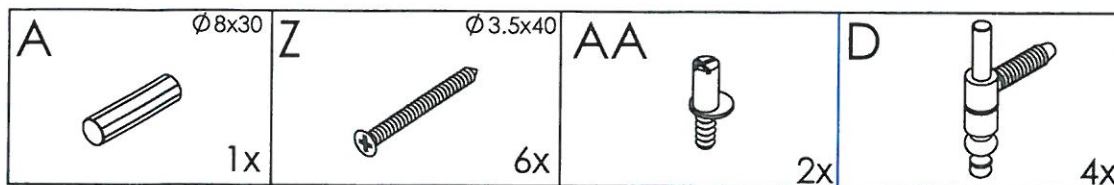

DETAIL B
SCALE 1 : 3






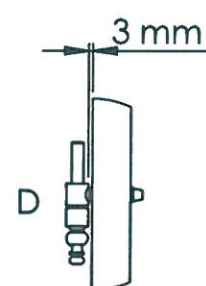



DETAIL B
SCALE 1 : 3

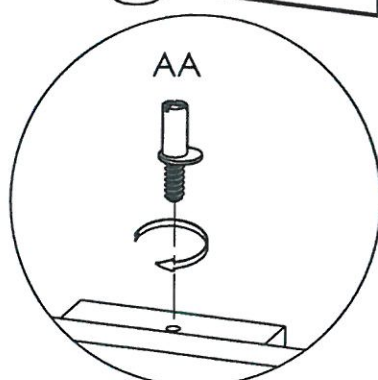


DETAIL A
SCALE 1 : 2

9. J  $\varnothing 2.9 \times 16$ 32x	AC  1489 mm 1x	E  $\varnothing 25$ 18x
---	---	--

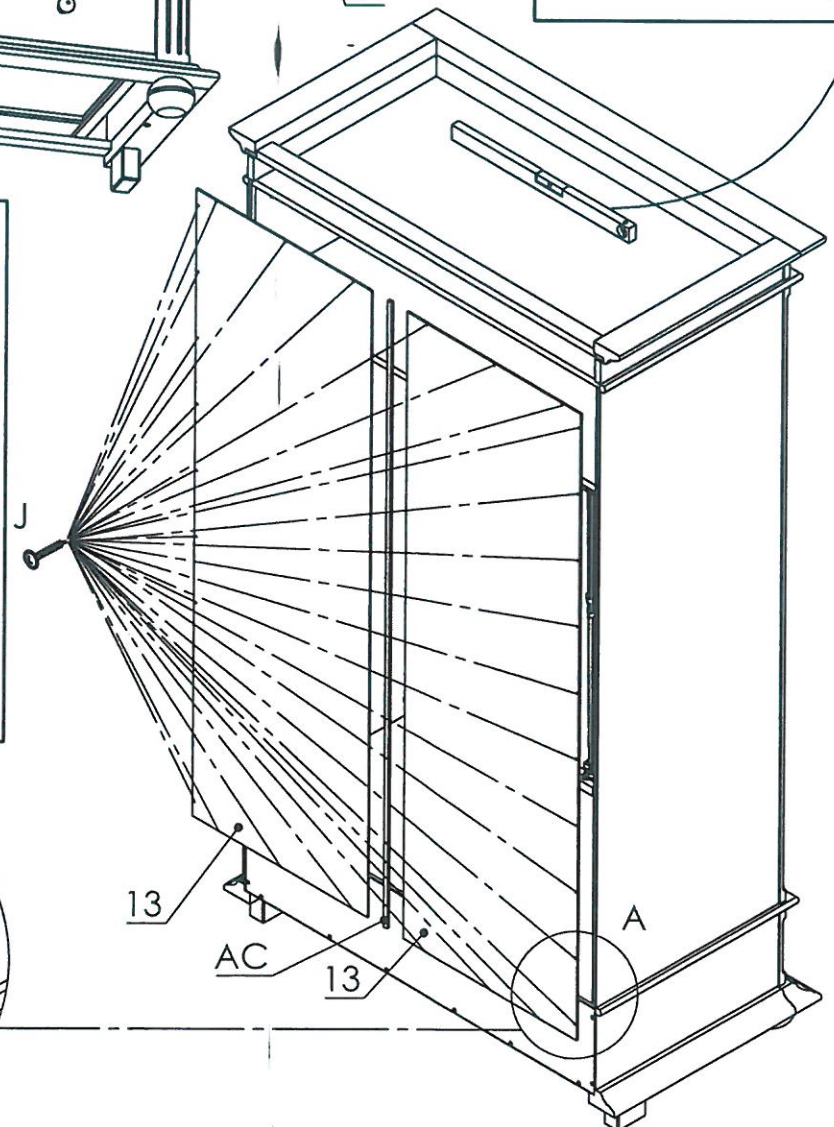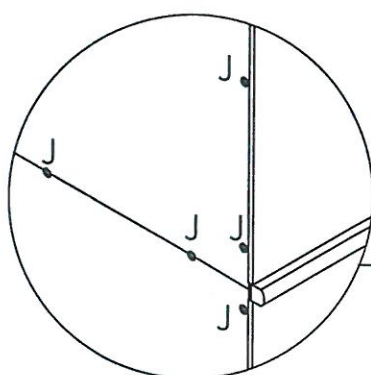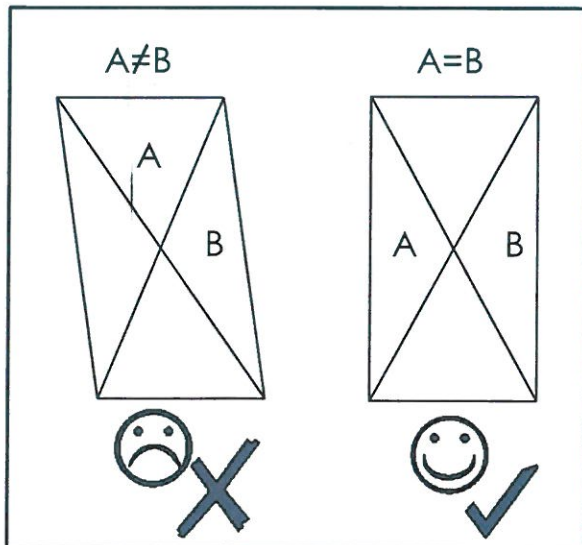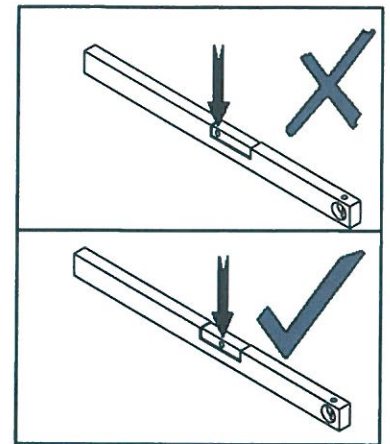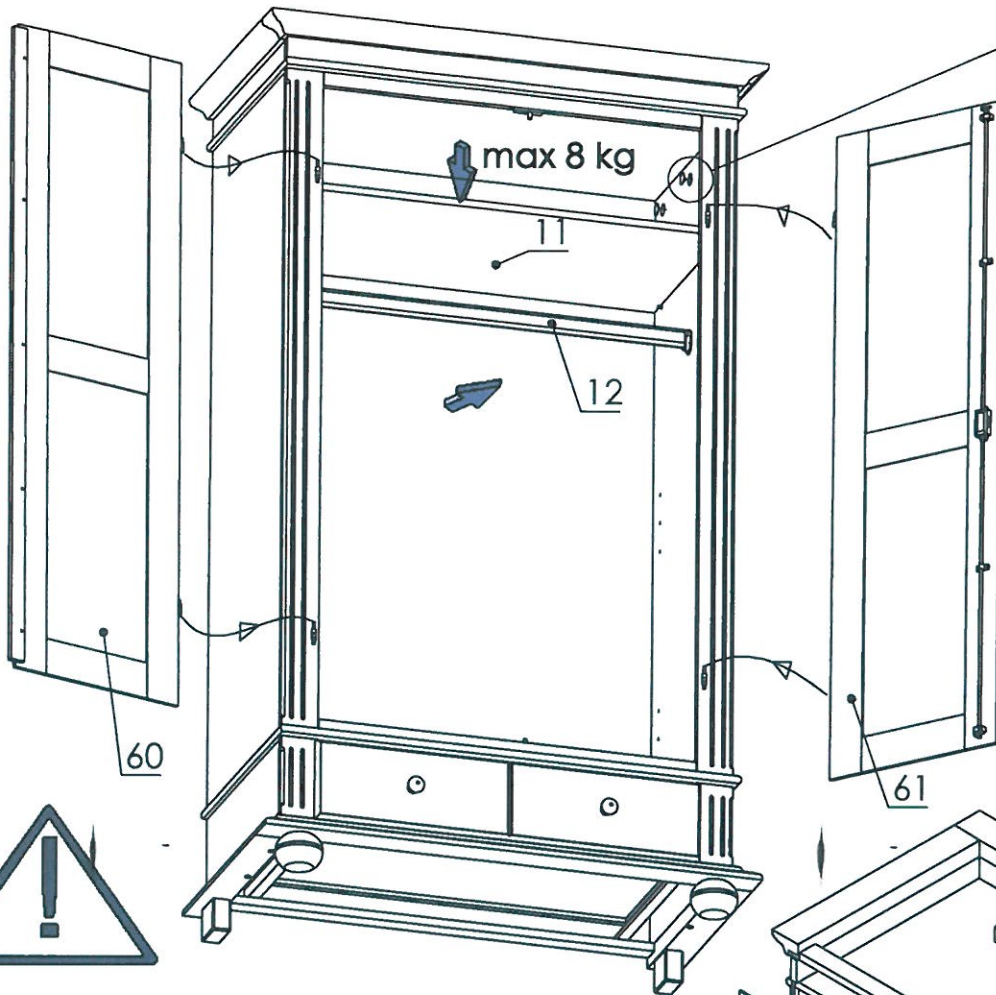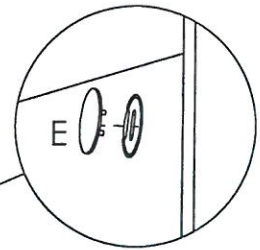

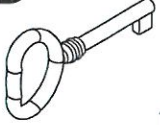
10. AD	AJ	AH $\varnothing 5 \times 50$	AG	O $\varnothing 3 \times 16$
 1x	 2x	 2x	 2x	 4x

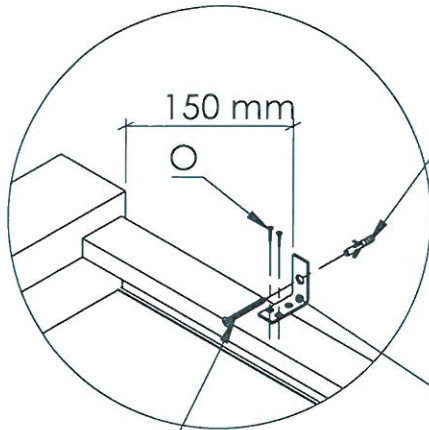


AH

AG

AJ

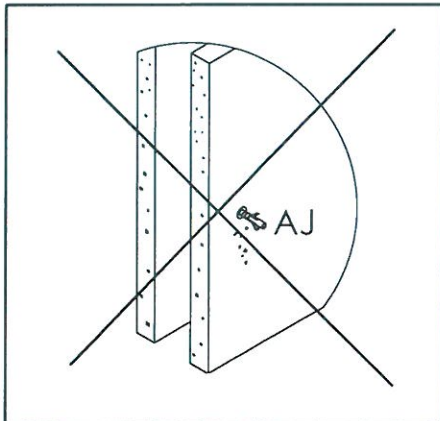

AJ

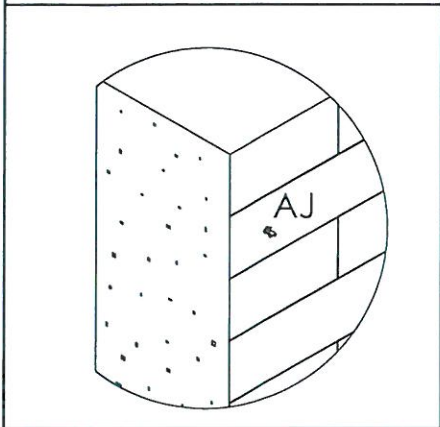

AJ

AD

